

To be effective, Chevron Alignment signs should be visible for at least 500 feet. The Chevrons should be attached to the adjustable bracket at an angle so headlight beams are not reflected back into the driver's eye. Trial runs at night may be desirable to determine final positioning.

The adjustable bracket shall be furnished in all aluminum or all galvanized steel products. All bolts shall include locking devices.





The price bid for "Guidance Marker, Chevron W1-8 (Special)" shall include furnishing and installing wood post, approved mounting bracket assembly, chevrons and all work necessary to install as shown.


Contract Item:

Guidance Marker, Chevron W1-8 (Special)

Tabulation: 108-34

① Adjust chevron locations as necessary to meet (S) as near as possible.

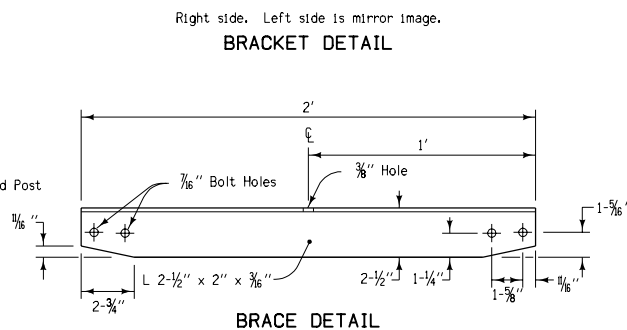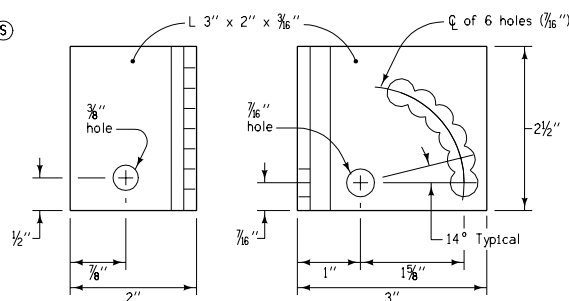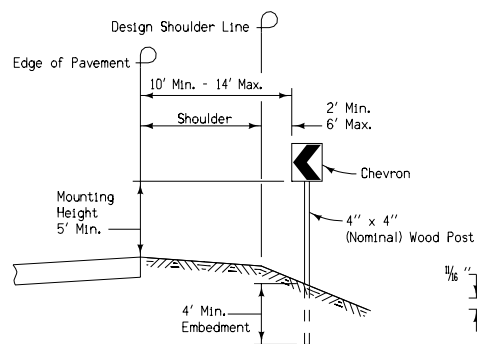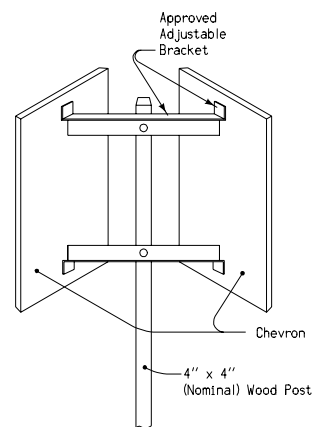

 Iowa Department of Transportation Highway Division	
STANDARD ROAD PLAN	RD-34
REVISION: New. Replaces Road Design Detail Sheet 540-6.	REVISION NO. New
APPROVED BY DESIGN METHODS ENGINEER <i>William J. Allen</i>	REVISION DATE 10-18-05
GUIDANCE MARKER CHEVRON (Installation & Placement)	